



#### **TEST REPORT**

**Report No.**: F7299.01-109-47

Rendered to:

MI WINDOWS AND DOORS, LLC Gratz, Pennsylvania

**PRODUCT TYPE**: Polyvinyl Chloride (PVC) Picture Window

**SERIES/MODEL**: HM155

**SPECIFICATION(S)**: AAMA/WDMA/CSA 101/I.S.2/A440-08, NAFS - North American Fenestration

Standard/Specification for Windows, Doors, and Skylights

| Title                                      | Summary of Results                                 |
|--|--|
| AAMA/WDMA/CSA 101/I.S.2/A440-08            | Class LC-PG50 1549 x 1676 (61 x 66)-FW             |
| Design Pressure                            | ±2400 Pa (±50.13 psf)                              |
| Air Infiltration                           | 0.3 L/s/m <sup>2</sup> (0.06 cfm/ft <sup>2</sup> ) |
| Water Penetration Resistance Test Pressure | 360 Pa (7.52 psf)                                  |

**Test Completion Date**: 04/12/16

Reference must be made to Report No. F7299.01-109-47, dated 06/03/16 for complete test specimen description and detailed test results. Reference Intertek-ATI Report No. F7297.01-109-47, dated 06/03/16 for complete *Gateway* test specimen description and test results.





Report Date: 06/03/16 Page 1 of 7

**1.0 Report Issued To**: MI Windows and Doors, LLC

650 West Market Street

P.O. Box 370

Gratz, Pennsylvania 17030-0370

**2.0 Test Laboratory**: Architectural Testing, Inc., an Intertek company ("Intertek-ATI")

130 Derry Court

York, Pennsylvania 17406-8405

717-764-7700

3.0 Project Summary:

3.1 Product Type: Polyvinyl Chloride (PVC) Picture Window

3.2 Series/Model: HM155

**3.2.1** This product also labeled under the following names: EC155, EC155MULL, HM155, HM155MULL, EC152, HM152, EC170, HM170, BB155, and BB170

- **3.3 Compliance Statement**: Results obtained are tested values and were secured by using the designated test method(s). The specimen tested successfully met the performance requirements for a **Class LC-PG50 1549 x 1676 (61 x 66)-FW** rating. Reference Intertek-ATI Report No. F7297.01-109-47, dated 06/03/16 for complete *Gateway* test specimen description and test results.
- **3.4 Test Dates**: 04/12/16
- **3.5 Test Record Retention End Date**: All test records for this report will be retained until April 12, 2020.
- **3.6 Test Location**: MI Windows and Doors test facility in Gratz, Pennsylvania. Calibration of test equipment was performed by Intertek-ATI in accordance with AAMA 205-01 "In-Plant Testing Guidelines for Manufacturers and Independent Laboratories".
- **3.7 Test Specimen Source**: The test specimens were provided by the client. Representative samples of the test specimen(s) will be retained by Intertek-ATI for a minimum of four years from the test completion date.
- **3.8 Drawing Reference**: The test specimen drawings have been reviewed by Intertek-ATI and are representative of the test specimen(s) reported herein. Test specimen construction was verified by Intertek-ATI per the drawings on file with Intertek-ATI. Any deviations are documented herein or on the drawings.





Report Date: 06/03/16 Page 2 of 7

3.0 Project Summary: (Continued)

## 3.9 List of Official Observers:

<u>Name</u> <u>Company</u>

Richie Williard MI Windows and Doors, LLC

Joel Chronister Intertek-ATI

# 4.0 Test Specification(s):

AAMA/WDMA/CSA 101/I.S.2/A440-08, NAFS - North American Fenestration Standard/Specification for Windows, Doors, and Skylights

## **5.0 Test Specimen Description:**

#### 5.1 Product Sizes:

| Overall Area:                              | Width       |        | Height      |        |
|--|-------------|--------|-------------|--------|
| 2.6 m <sup>2</sup> (28.0 ft <sup>2</sup> ) | millimeters | inches | millimeters | inches |
| Overall size                               | 1549        | 61     | 1676        | 66     |

#### **5.2** Frame Construction:

| Frame Member          | Material | Description   |  |  |
|-----------------------|----------|---|--|--|
| Head, sill, and jambs | PVC      | Extruded  |  |  |
| Track filler          | PVC      | Extruded, snap fit to the interior track of the head, sill, and jambs |  |  |

|             | Joinery Type | Detail           |
|-------------|--------------|------------------|
| All corners | Mitered      | Thermally welded |

## **5.3 Weatherstripping**: No weatherstripping was utilized.





Report Date: 06/03/16 Page 3 of 7

# **5.0 Test Specimen Description**: (Continued)

**5.4 Glazing**: No conclusions of any kind regarding the adequacy or inadequacy of the glass in any glazed test specimen(s) can be made.

| Glass<br>Type | Spacer Type                   | Interior<br>Lite | Exterior<br>Lite | Glazing Method  |
|---------------|-------------------------------|------------------|------------------|---|
| 3/4" IG       | Metal-<br>reinforced<br>butyl | 1/8"<br>tempered | 1/8"<br>tempered | Interior tape glazed with two-sided butyl tape, silicone in each corner, and secured with PVC snap-in glazing beads |

| Location               | Quantity | Dayligh     | Glass Bite      |            |
|------------------------|----------|-------------|-----------------|------------|
| Location               | Quantity | millimeters | inches          | Glass Bite |
| Fixed daylight opening | 1        | 1445 x 1572 | 56-7/8 x 61-7/8 | 1/2"       |

# 5.5 Drainage:

| Drainage<br>Method | Size                    | Quantity | Location                                 |  |  |
|--------------------|-------------------------|----------|--|--|--|
| Weephole with      | 1-5/8" wide by          | 2        | 3-1/2" from each end, through the        |  |  |
| cover              | 1/4" high               | 2        | exterior sill face                       |  |  |
| Woonslot           | 1/8" wide by            | 2        | 3-1/2" from each end, through the        |  |  |
| Weepslot           | 1/8" high               | 2        | glazing track                            |  |  |
| Woonslot           | 1-1/8" wide by          | 2        | 5/8" from each end inside the hollow     |  |  |
| Weepslot 1/4"      | 1/4" high               | 2        | chamber in the sill                      |  |  |
| Maanalat           | 1" wide by              | 2        | 2-1/4" from each end through the         |  |  |
| Weepslot           | 1/4" high               | 2        | interior snap-in cover                   |  |  |
| Weepslot           | 411 + 11 - 11 - 11 - 11 | 2        | 1" from each end of the internal snap-in |  |  |
|                    | 1" triangle             | 2        | cover                                    |  |  |

**5.6 Hardware**: No hardware was utilized.

**5.7 Reinforcement**: No reinforcement was utilized.





Report Date: 06/03/16

Page 4 of 7

#### 6.0 Installation:

The specimen was installed into a Spruce-Pine-Fir wood buck. The rough opening allowed for a 1/8" shim space. The exterior perimeter of the window was sealed with sealant.

| Location                 | Anchor Description         | Anchor Location   |
|--------------------------|----------------------------|---|
| Head, sill,<br>and jambs | #6 x 1-5/8" drywall screws | Located 3" from the corners and spaced 8" to 10" on center, through the mounting fin and into the wood buck |





Report Date: 06/03/16 Page 5 of 7

# **7.0 Test Results**: The temperature during testing was 19°C (67°F). The results are tabulated as follows:

| Title of Test                | Results                     | Allowed                         | Note    |
|------------------------------|-----------------------------|---------------------------------|---------|
| Air Leakage,                 |                             |                                 |         |
| Infiltration per ASTM E 283  | 0.3 L/s/m <sup>2</sup>      | 1.5 L/s/m <sup>2</sup>          |         |
| at 75 Pa (1.57 psf)          | (0.06 cfm/ft <sup>2</sup> ) | (0.3 cfm/ft <sup>2</sup> ) max. | 1, 6    |
| Water Penetration,           |                             |                                 |         |
| per ASTM E 547               | N/A                         | N/A                             | 2       |
| Uniform Load Deflection,     |                             |                                 |         |
| per ASTM E 330               | N/A                         | N/A                             | 2       |
| Uniform Load Structural,     |                             |                                 |         |
| per ASTM E 330               | N/A                         | N/A                             | 2       |
| Forced Entry Resistance,     |                             |                                 |         |
| per ASTM F 588,              |                             |                                 |         |
| Type: D - Grade: 10          | Pass                        | No entry                        |         |
| Thermoplastic Corner Weld    | Pass                        | Meets as stated                 |         |
|                              | <b>Optional Performance</b> |                                 |         |
| Water Penetration,           |                             |                                 |         |
| per ASTM E 547               |                             |                                 |         |
| 360 Pa (7.52 psf)            | Pass                        | No leakage                      | 6       |
| Uniform Load Deflection,     |                             |                                 |         |
| per ASTM E 330               |                             |                                 |         |
| Deflections taken at sill    |                             |                                 |         |
| +2400 Pa (+50.13 psf)        | 1.5 mm (0.06")              |                                 |         |
| -2400 Pa (-50.13 psf)        | 1.3 mm (0.05")              | Report only                     | 3, 4, 5 |
| Uniform Load Structural,     |                             |                                 |         |
| per ASTM E 330               |                             |                                 |         |
| Permanent sets taken at sill |                             |                                 |         |
| +3600 Pa (+75.19 psf)        | <0.3 mm (<0.01")            | 5.6 mm (0.22") max.             |         |
| -3600 Pa (-75.19 psf)        | <0.3 mm (<0.01")            | 5.6 mm (0.22") max.             | 4, 5    |





Report Date: 06/03/16 Page 6 of 7

# 7.0 Test Results: (Continued)

Note 1: The tested specimen meets (or exceeds) the performance levels specified in AAMA/WDMA/CSA 101/I.S.2/A440 for air leakage resistance.

Note 2: The client opted to start at a pressure higher than the minimum required. Test results are reported under Optional Performance.

Note 3: The deflections reported are not limited by AAMA/WDMA/CSA 101/I.S.2/A440 for this product designation. The deflection data is recorded in this report for special code compliance and information only.

Note 4: Loads were held for 10 seconds.

Note 5: Tape and film were used to seal against air leakage during structural testing. In our opinion, the tape and film did not influence the results of the test.

Note 6: Reference Intertek-ATI Report No. F7297.01-109-47, dated 06/03/16 for complete Gateway test specimen description and test results.





Report Date: 06/03/16 Page 7 of 7

Intertek-ATI will service this report for the entire test record retention period. Test records such as detailed drawings, datasheets, representative samples of test specimens, or other pertinent project documentation, will be retained by Intertek-ATI for the entire test record retention period.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. It is the exclusive property of the client so named herein and relates only to the specimen(s) tested. This report may not be reproduced, except in full, without the written approval of Intertek-ATI.

For ARCHITECTURAL TESTING, INC.

Joel Chronister Technician

Timothy J. McGill Manager - Product Testing

JC:asm/cmd

Attachments (pages): This report is complete only when all attachments listed are included.

Appendix-A: Alteration Addendum (1) Appendix-B: Location of Air Seal (1)

Appendix-C: Complete drawings packet on file with Intertek-ATI.

This report produced from controlled document template ATI 00438, revised 06/27/14.





Report Date: 06/03/16

# Appendix A

# **Alteration Addendum**

**Note**: No alterations were required.






Test Report No.: F7299.01-109-47 Report Date: 06/03/16

#### **Appendix B**

**Location of Air Seal**: The air seal between the test specimen and the test wall is detailed below. The seal is made of foam weatherstripping and is attached to the edge of the test specimen buck. The test specimen buck is placed against the test wall and clamped in place, compressing the weatherstripping and creating a seal.

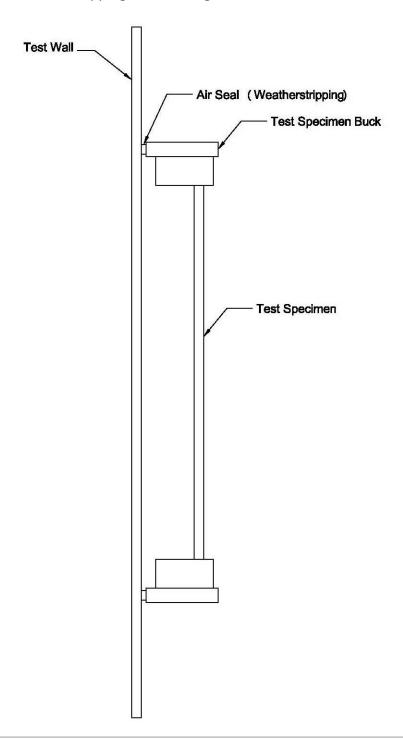





Report Date: 06/03/16

# **Appendix C**

Drawing(s)

**Note**: Complete drawings packet on file with Intertek-ATI.